

AIRWORTHINESS DIRECTIVE

This Airworthiness Directive, issued by the Civil Aviation Administration in accordance with the Israeli Aviation Regulations, applies to an aircraft for which our records list you as the registered owner. It affects aviation safety and requires your immediate attention. No person may operate an aircraft to which an Airworthiness Directive applies, except in accordance with that Directive.

- APPLIES TO: Israel Aircraft Industries Ltd. (IAI),
models 1123,1124 and 1124A all serial numbers.
- SUBJECT: Inspection for exterior corrosion of the aileron
control rod assemblies, part number 513506-503.
- REASON: Inspection of 3 model 1124 aircraft as per
Service Bulletin 1124-27-100 revealed the aileron
control rods corroded and required replacement.
- ACTION: 1. Within the next 20 flight hours time in
service after the effective date of this AD,
unless previously inspected within the last
130 flight hours time in service, inspect the
aileron control rod assemblies P/N 513506-503
in accordance with ACCOMPLISHMENT INSTRUCTIONS
of the IAI Service Bulletins:
- Model 1123 - S.B.1123-27-026 Rev.1
Models 1124 and 1124A - S.B.1124-27-100 Rev.1
2. If no corrosion is found, repeat this
inspection at intervals not exceeding 150
flight hours.

EFFECTIVE DATE: 24 April 1990